


**FAG****HCM7011-C-T-P4S-UL-XL**

High speed spindle bearing

High speed spindle bearing HCM70..-C, adjusted, in pairs or sets, contact angle $\alpha = 17^\circ$, with ceramic balls, restricted tolerances

Informacje techniczne

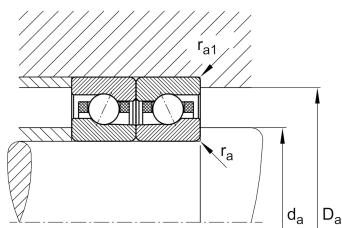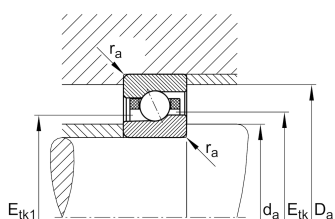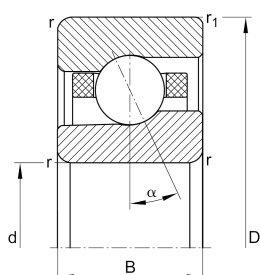

Twoja aktualna wersja produktu

Preload	L	Preload light
Contact angle	Contact angle 17°	Contact angle 17°
Sealing	Without	Not sealed
Cage	T	Laminated fabric cage
Tolerance class	P4S	Tolerance class P4S, FAG standard better than P4 to ISO 492:2023
Arrangement bearing set	U	Single bearing

Main Dimensions & Performance Data

d	55 mm	Bore diameter
D	90 mm	Outside diameter
B	18 mm	Width
C _r	19.500 N	Basic dynamic load rating, radial
C _{0r}	10.500 N	Basic static load rating, radial
C _{ur}	850 N	Fatigue load limit, radial
n _{G Grease}	28.000 1/min	Limiting speed for grease lubrication
n _{G Oil}	40.000 1/min	Limiting speed for oil lubrication
≈m	363,6 g	Masa



Mounting dimensions

d _a	62 mm	Diameter shaft shoulder
d _a	h12	Diameter shaft shoulder clearance
D _a	83 mm	Shoulder diameter outer ring
D _a	H12	Shoulder diameter outer ring clearance
r _a max	1 mm	Maximum recess radius
r _{a1} max	0,6 mm	Maximum recess radius
E _{tk} min	67,7 mm	Minimum diameter injection pitch
E _{tk} max	70,1 mm	Maximum diameter injection pitch
E _{tk1} min	64,7 mm	Minimum diameter injection pitch
E _{tk1} max	70,1 mm	Maximum diameter injection pitch
a	20,1 mm	Distance between the apexes of the pressure cones

Dimensions

r _{min}	1,1 mm	Minimum chamfer dimension
r ₁ min	0,6 mm	Minimum chamfer dimension
α	17 °	Contact angle

Temperature range

T _{min}	-30 °C	Operating temperature min.
T _{max}	100 °C	Operating temperature max.



Additional information

F_{VL}	81 N	Preload force light
F_{VM}	214 N	Preload force medium
F_{VH}	450 N	Preload force heavy
K_{aEL}	236 N	Lift-off force light
K_{aEM}	638 N	Lift-off force medium
K_{aEH}	1.378 N	Lift-off force heavy
c_{aL}	54 N/μm	Axial rigidity light
c_{aM}	78 N/μm	Axial rigidity medium
c_{aH}	105 N/μm	Axial rigidity heavy

Właściwości

- 

Obciążenie promieniowe
- 

Obciążenie osiowe jednokierunkowe
- 

Smarowanie smarem
- 

Smarowanie olejem
- 

Bez uszczelnienia