




FAG

HCM71911-C-T-P4S-UL-XL

High speed spindle bearing

High speed spindle bearing HCM719...-C, adjusted, in pairs or sets, contact angle $\alpha = 17^\circ$, with ceramic balls, restricted tolerances

Informacje techniczne

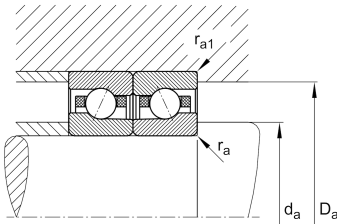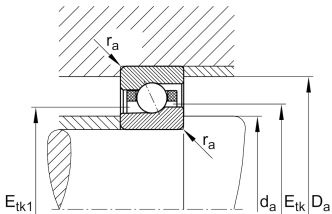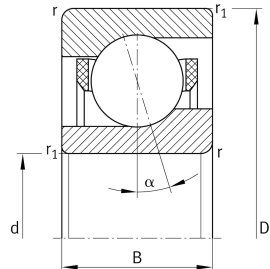

Twoja aktualna wersja produktu

Preload	L	Preload light
Contact angle	Contact angle 17°	Contact angle 17°
Sealing	Without	Not sealed
Cage	T	Laminated fabric cage
Tolerance class	P4S	Tolerance class P4S, FAG standard better than P4 to ISO 492:2023
Arrangement bearing set	U	Single bearing

Main Dimensions & Performance Data

d	55 mm	Bore diameter
D	80 mm	Outside diameter
B	13 mm	Width
C _r	18.500 N	Basic dynamic load rating, radial
C _{0r}	9.500 N	Basic static load rating, radial
C _{ur}	760 N	Fatigue load limit, radial
n _{G Grease}	30.000 1/min	Limiting speed for grease lubrication
n _{G Oil}	45.000 1/min	Limiting speed for oil lubrication
≈m	143,51 g	Masa



Mounting dimensions

d _a	60 mm	Diameter shaft shoulder
d _a	h12	Diameter shaft shoulder clearance
D _a	75,5 mm	Shoulder diameter outer ring
D _a	H12	Shoulder diameter outer ring clearance
r _a max	0,6 mm	Maximum recess radius
r _{a1} max	0,3 mm	Maximum recess radius
E _{tk} min	62,7 mm	Minimum diameter injection pitch
E _{tk} max	65,1 mm	Maximum diameter injection pitch
E _{tk1} min	59,7 mm	Minimum diameter injection pitch
E _{tk1} max	65,1 mm	Maximum diameter injection pitch
a	16,8 mm	Distance between the apexes of the pressure cones

Dimensions

r _{min}	1 mm	Minimum chamfer dimension
r ₁ min	0,6 mm	Minimum chamfer dimension
α	17 °	Contact angle

Temperature range

T _{min}	-30 °C	Operating temperature min.
T _{max}	100 °C	Operating temperature max.



Additional information

F_{VL}	73 N	Preload force light
F_{VM}	194 N	Preload force medium
F_{VH}	406 N	Preload force heavy
K_{aEL}	213 N	Lift-off force light
K_{aEM}	576 N	Lift-off force medium
K_{aEH}	1.243 N	Lift-off force heavy
c_{aL}	49 N/μm	Axial rigidity light
c_{aM}	71 N/μm	Axial rigidity medium
c_{aH}	95 N/μm	Axial rigidity heavy

Właściwości

- 

Obciążenie promieniowe
- 

Obciążenie osiowe jednokierunkowe
- 

Smarowanie smarem
- 

Smarowanie olejem
- 

Bez uszczelnienia